



HS610 Sensor



Overview

The HS610 sensor has uniquely designed optics that makes it ideal for use in measuring outside and inside radii on stamped and machined parts and for inspecting features of spot welds and fasteners. It has all of the functionality of the HS305 sensors, but with a lighter weight and more compact design.



Operating Features

Design - Without the handle of the HS305 sensor, the HS610 can fit into tighter areas. Based on the application, the cable strain relief can be positioned during manufacturing horizontally to the inspection surface (as shown in the photo above) or vertically out of the top of the sensor. An inlaid rubber pad on both sides of the sensor helps to keep the sensor securely gripped.



Trigger - Low-tactile trigger buttons are located on either side of the sensor. Either button can be used as the trigger, depending on the preference of the operator.

Operator Feedback - Three LED's at the front and the rear of the sensor direct the operator to roll the sensor to the correct angle before the scan is completed. A 2 x 16 LCD is used to display messages, alerting the operator of scanning errors, indicating when a good scan has been completed, showing the measurement value returned and providing instructions on where the next measurement is to be taken.



Removable Standoffs - Standoffs are used only to position the sensor above the surface at an optimum distance and to guide the sensor to the center of the feature being measured. They are not a factor in the calculations made. Standoffs are designed to the requirements of the application and can be changed by the operator when the sensor is used for different measurements.

Automatic Gain Adjustment - The sensor's microcontroller automatically adjusts the intensity of the laser and the gain of the camera to optimize the sensor's performance on the various surface finishes, from raw metal to the full spectrum of painted colors.

Mounting Options - The sensor housing offers two threaded holes on the front and two on the backside of the sensor for use in mounting the sensor to a fixture.

Applications

Butt Weld	Weld bead characteristics and mismatch of panels
Radius	Inside and outside radii
Flange Length/Angle	Length of flange on one side of radius and angle of flange relative to panel on other side of radius
Gap/Flush	Measurements of gap and flush in check fixtures
Spot Welds	Depth of indentations, angle of distortion and height of eruptions

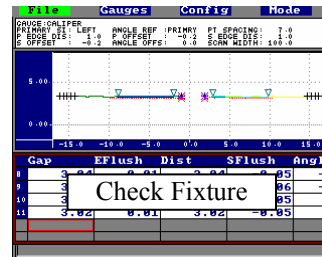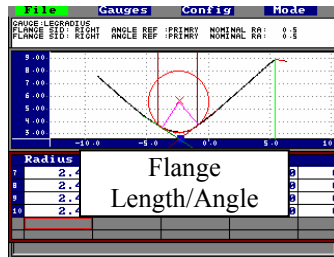

Advantages

Stability - The sensor is held from the top and the operator guides it downward until the standoffs come to rest in the desired position. As with the HS602 sensor, the operator is more likely to hold the sensor steady during the scanning process because of the size of the sensor and because holding pressure is exerted downward.

Reflectivity - The sensor is designed to minimize the reflections that can occur when the laser is aimed at an inside radius or on the edges of a weld.

Sensor Specifications

Type	Handheld
Size	1.6" (w) x 5.0" (h) x 3.0" (l)
Weight	14 oz
User Interface	2-row x 16-character LCD, 2 sets of 3 LED's
Cable Length	5' (1.5m) extended
FOV Options/Resolution	0.75" (20mm) / 0.0008" (20µm) 1.25" (32mm) / 0.001" (25µm)
Shock Protection	Coiled spring cable
Environment	0° – 70° C

 **Origin** Technologies Corporation

9238 Madison Boulevard, Building 1, Suite 845 • Madison, Alabama 35758 USA
Phone 256.461.1313 • Fax 256.461.1390

Our continuing commitment to quality products may mean a change in specifications without notice.

© Origin Technologies Corporation • This system complies with 21 CFR Chapter I, Subchapter J.

www.origintech.com

